

## IMPORTANT SAFETY NOTICE

TO: Insert Customer Name

DATE: November 8, 2001

**PRODUCT AFFECTED:** Type G105, G106 & G107 Back Check Valves  
Shipped During August, September & October, 2001

Fisher Controls has authorized us to send this **IMPORTANT SAFETY NOTICE** to you.

**PROBLEM:** Fisher Controls found an assembly problem with the G105, G106 and G107 steel Back Check Valves which could hinder the guiding and prevent the proper seating of the disc. **This improper seating is a potential safety problem, which could cause a fire and/or explosion resulting in property damage or personal injury if there were a hose or piping failure that required the back check to shutoff the flow of product.**

The G105, G106, and G107 Back Check Valves are date stamped (8-01, 9-01 or 10-01) with the month and year of manufacture. Both the type number and date are located on one of the hexagon flats of the valve body. Individual Fisher box cartons will be dated in August, September or October 2001.

Fisher Controls will replace or rework if appropriate any returned valves at no charge. If you have installed product, it should be identified and you should contact your Fisher Distributor with this information. The Distributor and Fisher Controls will work with you to determine the best method for replacing the back check valves.

### **WHAT YOU SHOULD DO:**

The attached sheet indicates the number of valves you received during August, September and October 2001, your purchase order number and the date that these were shipped to you. You must take the following actions:

- (1) **Check your inventory** of G105, G106, and G107 Back Check Valves for manufacturing stamped dates of 8-01, 9-01 or 10-01, or that have their box labels dated in August, September or October 2001.
- (2) **Return for replacement any inventory** that is found with these manufacturing dates to your Fisher Distributor.
- (3) **Locate any product that is installed.** Contact your Fisher Distributor to work out the details to replace the installed valve.


Thank you for your cooperation in this important matter, and we apologize for the inconvenience this will cause. Please contact (Insert Distributor contact) at phone (insert your phone number or other contact methods) to discuss any questions you have or to return valves for replacement.

Sincerely yours,

Distributor Contact & Title

Attachments

cc: Fisher Controls

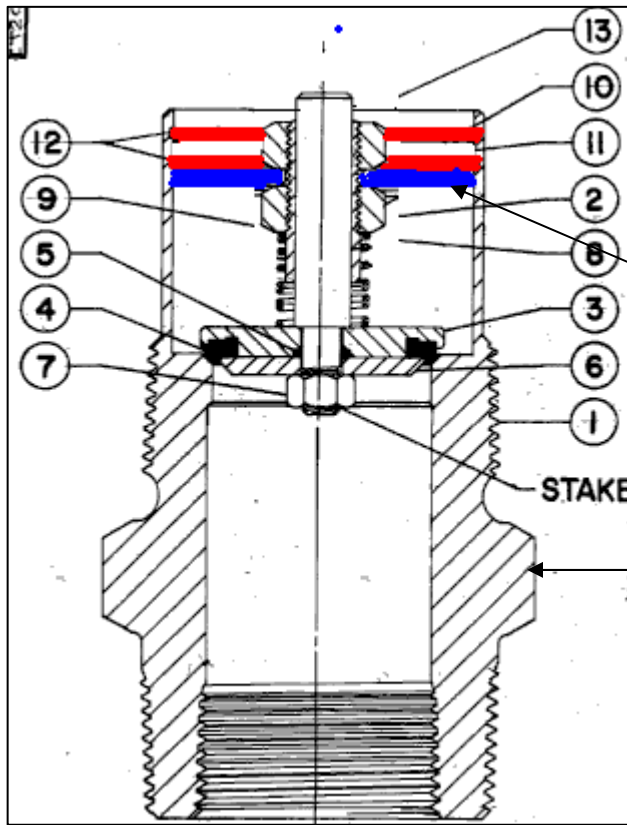

Guide (11) installed below lower retaining ring (12). Guide (11) should be installed between retaining rings (12)

Type Number & Date stamped here.  
 Example:  
 G107  
 8-01

**INCORRECT ASSEMBLY  
 G105, G106 OR G107  
 BACK CHECK VALVE**